

Saspiedcjs (Contractor) un FTx izsmidzināðanas pistoles

Saspiedcja (Contractor) modeiï: 288420, 288421, 288425, 288475, 288477, 288478, 826085, 288009, 262114, 17C926

FTx modeiï: 288427, 288428, 288429, 288430, 288431, 288436, 288438, 288477, 288478,

826086, 288008, 262116, 826256


Maksimālais darba spiediens: 3600 psi (248 bar, 24,8 MPa)



312278J
LV



SVARĪGAS DARBA DROÐĪBAS INSTRUKCIJAS. Jūsu izsmidzinātāja instrukciju rokasgrāmatā atrodamas instrukcijas par spiediena atlaiðanu, izsmidzinātāja sākotnējo uzpildīðanu un izsmidzināðanu.
Ievçrojet ðīs instrukcijas.

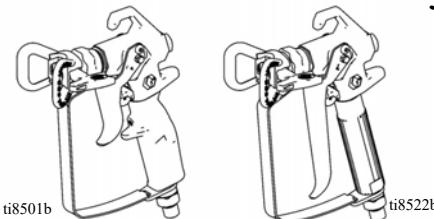

- Lietoðanai tieði darbam ar arhitektûras krâsâm un pârklâjumiem -

Sekojoðie brîdinâjumi attiecas uz ðīs iekârtas salikðanu, lietoðanu, iezemçðanu, apkopi un remontu. Izsaukuma zîmes simbols ir vispârîgs brîdinâjums, bet briesmu simbols attiecas uz specifiskiem procedûrâs riskiem. Vçlreiz izskatiet ðos brîdinâjums. Papildus tam, produktam specifiski brîdinâjumi atrodami visâ ðajâ rokasgrâmatâ, attiecîgajâs vietâs.



BRÎDINÂJUMI



ÂDAS SADURÐANAS RISKS

Augstspiediena ðiidrums no pistoles, cauruma ðiûtenç vai plisûðâm detaiâm var savainot âdu. Tas var izskatîties kâ tikai iegriezums, tomçr tâ ir nopietna trauma, kuras rezultâts var bût amputâcija. **Nekavçoties vçrsieties pç medicîniskas palidzibâs.**

- Nevçrsiet pistoli pret ciemciem cilvçkiem vai jebkuru sava íermeoa daïu.
- Neliecirot roku uz sprauslas gala.
- Neapturiet vai nenovirziet noplûdes ar roku, íermenî, cimdu vai lupatu.
- Neizsmidzinet, ja nav uzstâdîts uzgaïa aizsargs un trigera aizsargs.
- Kad neizsmidzinet, izmantojet trigera droðibas slçdzi.
- Veiciet **spiediena atlaiðanas procedûru** kâda norâdîta ðajâ rokasgrâmatâ, kad jûs pârtraucat izsmidzinâðanu un pirms iekârtas tîrîðanas, pârbaudes vai apkopes.



UZLIESMOÐANAS UN SPRÂDZIENA RISKS

Ugunsnedroði izgarojumi, piemçram, no ðiîdinâtâja vai krâsas, **darba vietâ** var aizdegties vai uzsprågt. Lai nepieïautu aizdegðanos vai sprâdzienu:

- Izmantojet iekârtu tikai vietâ ar labu ventilâciju.
- Novçrsiet visus aizdegðanâs avotus, piemçram, degiùs, cigarettes, pârnçsâjamas elektrolampas un plastmasas pilienu uztverðanas pârklâjus (statiskâs lokizlâdes risks).
- Darba vietâ nedrîkst bût gruþi, ðiîdinâtâji, lupatas un benzâns.
- Nievienojiet un neatvienojiet strâvâs vadus, kâ arî neieslçdziet un neizslçdziet baroðanas avotu un gaismu, ja tuvumâ ir ugunsnedroði izgarojumi.
- Iezemçjet visu iekârtu darba vietâ. Skatît **iezemçðanas** instrukcijas.
- Lietojet tikai iezemçtas ðiûtenes.
- Ielaiþot spaini, stingri turiet pistoli pie iezemcta spaiða sâniem.
- Ja parâdâs statiska dzirksteiðana vai jûs sajûtat elektrisku triecieni, **nekavçoties pârtrauciet darbu**. Neizmantojet iekârtu, pirms neesat noskaidrojis un novçrsis problçmu.
- Darba vietâ jâbût darbaspcjîgam liesmu slâpçtâjam.



RISKS NEPAREIZI IZMANTOJOT IEKÄRTU

Nepareiza izmantoðana var izraisît nâvi, vai nopietnu savainojumu.

- Nedarbiniет iekârtu, kad esat noguris vai atrodieties narkotiku vai alkohola ieteikmç.
- Nepârsniegt maksimâlo darba spiedienu vai temperatûras diapazonu tai sistemas komponentei, kurai ir viszemâkais nominâlais lielums. Skatît **tehniskos datus** visâs iekârtas rokasgrâmatâs.
- Izmantojet ðiidrumus un ðiîdinâtâjus, kuri ir savietojami ar iekârtas slapjajâm daïäm. Lasiet **par tehniskiem datiem** visâs iekârtas rokasgrâmatâs. Izlasiet ðiidruma un ðiîdinâtâja raþotâja brîdinâjumus. Lai saðemtu pilnu informâciju par jûsu materiâlu, pieprasiet MSDS etiîties no izplatitâja vai mazumtirgotâja.
- Katru dienu pârbaudiet iekârtu. Nekavçoties salabojet vai nomainiet nolietojuðâs vai bojâtâs daïas tikai ar îstâm izgatavotâja rezerves daïäm.
- Neizmainiet vai nemodificjiet iekârtu.
- Izmantojet iekârtu tikai tam nolükam, kam tâ paredzcta. Lai saðemtu informâciju, griezieties pie jûsu izplatitâja.
- Nepieïaut, ka ðiûtenes un kabefi atrodas satiksmes joslâs, uz asâm ðiautnçm, kustigu daïu un karstu virsmu tuvumâ.
- Nesameglarlojet vai pârak nesalociet ðiûtenes, kâ arî neizmantojet ðiûtenes, lai vilktu iekârtu.
- Neïaut bçrniem un dzîvniekiem uzturcties darba vietâ.
- Saskaðojet ar visiem spçkâ esoðiem darba droðibas noteikumiem.



ALUMÎNIJA DAÏU SPIEDIENA RISKS

Augstspiediena alumîniija iekârtâ neizmantojet 1,1,1 tri-hloretânu, metilçna hlorîdu, citus halogençtus ogiûdeòraþa ðiîdinâtâjus vai ðiidrumus, kas satur ðâodus ðiîdinâtâjus. Ðâdu vielu izmantoðana var izraisît bîstamu ïfîmisku reakciju un iekârtas plisumu, kas var izraisît nâvi, nopietnu traumu un îpaðuma bojâjumu.



PERSONÂLIE AIZSARGLÎDZEKÎI

Strâdajot, veicot apkopi vai atrodoties iekârtas darbinâðanas vietâ, jums ir jâvâlkâ atbilstoði aizsarglîdzeķi, lai palidzçtu aizsargât jûs no nopietnâm traumâm. Die aizsarglîdzeķi ietver, tomçr var neaprobejties ar tiem:

- Aizsargbrilles
- Apicrbs un respirators saskaðâ ar ðiidruma un ðiîdinâtâja raþotâja ieteikumiem
- Cimdi
- Ausu aizsargs

Spiediena atlaiðanas procedûra



BÎSTAMÎBA



Ievçrojiet ðo **spiediena atlaiðanas procedûru** visos gadijumos, kad jums saskaðâ ar norâdijumiem, jāatlaip spiediens, jāaptur izsmidzinâðana, jâpârbauda vai jâapkalpo iekârta vai arî jâpievieno vai jâiztîra izsmidzinâðanas uzgalis.

1. Izslēdziet (OFF) baroðanu un pagrieziet izsmidzinâtâja spiediena vadîbu uz zemâko spiediena iestatîjumu.
2. Turiet pistoli pret iezemtâ metâla skaloðanas spaiða sânu. Ieslēdziet pistoli virzot to spaini lai atlaistu spiedienu.

Ja jums ðîiet, ka izsmidzinâðanas uzgalis vai ðîûtene ir aizsprostota vai ka spiediens pçc augðmincto soïu izpildiðanas nav pilnîgi noðemts, vispirms ïOTI LÇNI atlaidiet uzgaïa aizsarga fiksâcijas uzgriezni vai ðîûtenes gala savienotâju, lai pakâpeniski noðemtu spiedienu, pçc tam atlaidiet pilnîgi. Iztîriet ðîûtenes vai uzgaïa aizsprostoju.

Pistoles trigaðra droðibas slçdzis (2)




BÎSTAMÎBA




Lai nepieïautu ievainojumu tad, kad pistole netiek izmantota, vienmçr uzlieciet pistoles trigaðra droðibas slçdzi (2) ja iekârta tiek izslçgta vai atstâta bez uzraudzibas.

Trigaðra aizsargs uzlikts
(nav izsmidzinâðanas)

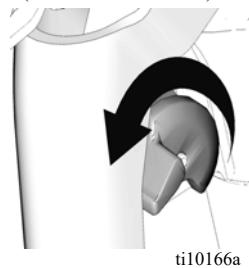

ti10166a

Trigaðra aizsargs noðemts
(izsmidzinâðana)

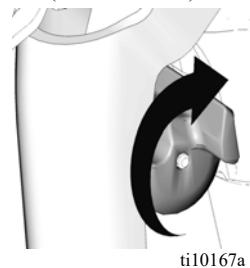

ti10167a

Salikðana



BÎSTAMÎBA

Pârliecineties, ka izsmidzinâtâjs ir izslçgts un kontaktakdâa izvilkta no baroðanas avota. Sâkotnçjâs uzpildiðanas instrukcijas un izsmidzinâðanas instrukcijas skatiet izsmidzinâtâja instrukciju rokasgrâmatâ.

Pievienojiet pistoli pie izsmidzinâtâja

1. Pievienojiet padeves ðiûteni izsmidzinâtâja ðiidruma izejai.
2. Pievienojiet padeves ðiûtenes otru galu pistoles ðarnîram (8). Izmantojiet divas uzgrieþou atslçgas (vienu pie ðarnîra (8) un otru pie ðiûtenes), lai pievilktu vîsus savienojumus.
3. Sâkotnçjâs uzpildiðanas instrukcijas skatiet izsmidzinâtâja instrukciju rokasgrâmatâ.

Pievienojot uzgali (26) un aizsargu (25) pie pistoles



BÎSTAMÎBA



1. Ja iekârta nesen tikusi darbinâta, **atlaidiet spiedienu**. Uzlieciet trigaðra droðibas slçdzi (2).

2. Ar zîmuli vai lîdzigu priekðmetu, ievietojet blîvçjumu (24) aizsarga aizmugurç (25).
3. Novietojet aizsargu (25) uz pistoles gala (1).
4. Ievietojet uzgali (26) aizsargâ (25). Pievelciet sprostuzgriezni.

Ekspluatâcija

Izsmidzinâðana

1. Atbrîvojiet trigaðra droðibas slçdzi (2).
2. Pârliecinieties, ka bultveida uzgalis (26) vîrsts uz priekðu (izsmidzinâðana).
3. Turiet pistoli perpendikulâri un apmçram 12-collas (304 mm) no vîrmas. Vispirms kustiniet pistoli, tad pavelciet pistoles trigeri (13) lai smidzinâtu testa paraugu.
4. Lçni palieliniet sâkâa spiedienu lîdz pârklâjums ir viendabîgs un vienmçrîgs (papildu informâciju skatît izsmidzinâtâja instrukciju rokasgrâmatâ).

Izsmidzinâðanas noregulçðana




BÎSTAMÎBA



1. Atlaidiet spiedienu. Uzlieciet trigaðra droðibas slçdzi (2).

2. Atlaidiet aizsarga sprostuzgriezni.
3. Savietojet aizsargu (25) horizontâli lai izsmidzinâtu horizontâlu paraugu.
4. Savietojet aizsargu (25) vertikâli lai izsmidzinâtu vertikâlu paraugu.

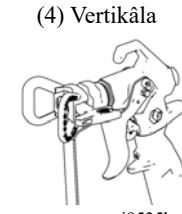

ti9535b

ti9535b

Traucçkiu tîrîðana




BÎSTAMÎBA

1. **Atlaidiet spiedienu.** Uzlieciet trigaðra droðibas slçdzi (2).
2. Grieziet uzgali (26) 180°. Atbrîvojiet trigaðra droðibas slçdzi (2). Izsmidziniet ar pistoli spaini vai zemç lai izskalotu aizsprostoju.
3. Uzlieciet trigaðra droðibas slçdzi (2). Pagrieziet uzgali (26) 180° atpakaï uz izsmidzinâðanas stâvokli.

Tîrîðana


Skalojiet pistoli pçc katras darba maiðas un uzglabâjet sausâ vietâ. Neatstâjiet pistoli vai jebkuras daïas ûdeni vai tîrîðanas ðîidinâtâjos.

Daiias

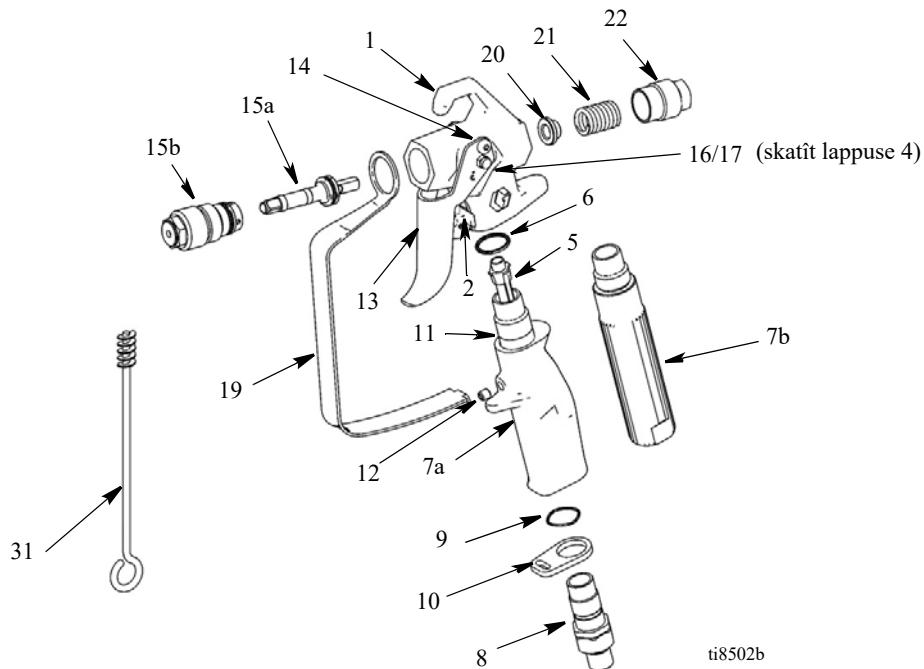

Ref No.	Part. No.	Description	Qty	Ref No.	Part. No.	Description	Qty
1	288812	HOUSING, assy., Contractor	1	13	15J409	TRIGGER, Contractor/FTX Gun, 2 finger	1
	289914	HOUSING, assy., FTX	1	15J768	TRIGGER, Contractor Gun, 4-finger (not shown)	1	
5	287032	FILTER, 60 mesh	1	15J769	TRIGGER, FTX Gun, 4-finger (not shown)	1	
	287033	FILTER, 100 mesh	1	14	117602	SCREW, shoulder, pan hd	2
	287034	FILTER, 60 and 100 mesh combo	1	15	288488	KIT, needle, repair	1
6	120777	PACKING, o-ring	1	15a	288488	NEEDLE, assembly	1
7	HANDLE		1	15b	15J696	DIFFUSER, assembly	1
7a	15K282	Contractor Gun	1	16	15J696	PIN, trigger (lappuse 4)	1
7b	15J735	FTX Gun	1	17	105334	NUT, lock, hex (lappuse 4)	1
	15J736	FTX-A Gun (not shown)	1	19	15J464	GUARD, trigger	1
8	288811	SWIVEL, assy, gun	1	20	15J528	GUIDE, spring	1
9	120733	O-RING, urethane, clear	1	21	121093	SPRING, compression	1
10	15J706	RETAINER, guard, trigger	1	22	15B549	NUT, end	1
11	15J698	TUBE, handle, Contractor Gun	1	31	119799	BRUSH, cleaning	1
12	120834	SCREW, set, Contractor Gun	1				

Uzgalis un aizsargs

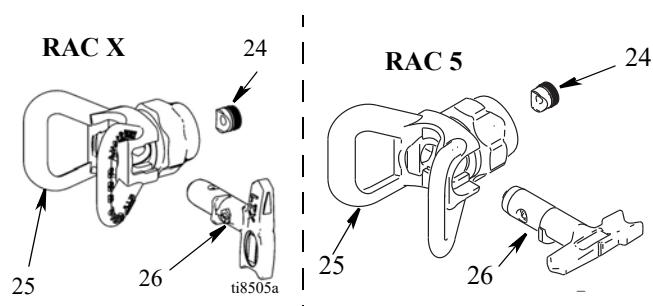

Ref No.	Part. No.	Description	Qty
24	246453	OneSeal™, RAC X (5-pack)	1
	243281	OneSeal™, RAC 5 (5-pack)	1
25	246215	GUARD, RAC X	1
	243161	GUARD, RAC 5	1
26	LTX515	TIP, spray 515, RAC X	1
	LTX517	TIP, spray 517, RAC X	1
	286515	TIP, spray 515, RAC 5	1
	286517	TIP, spray 517, RAC 5	1
	PAA517	TIP, spray 517, RAC X Europe	1
	PAA515	TIP, spray 515, RAC X Europe	1
	262517	TIP, spray 517, RAC 5 Europe	1
	LP515	TIP, spray, LP 515, RAC X	1
	LP517	TIP, spray, LP 517, RAC X	1

Apkope

BÎSTAMÎBA

Pirms jūs veiciet jebkādu pistoles apkopi, izlasiet visus brīdinājumus uz ūs rokasgrāmatas priekšējā vāka un **atlaidiet spiedienu**.

Filtra (5) tîrîðana/nomaiòa



1. **Atlaidiet spiedienu.** Uzlieciet trigera droðības slēdzi (2).


2. Atvienojiet ūidruma ūiûteni no pistoles pie ðarnîra (8).
3. Atvienojiet trigera aizsargu (19) no aizsarga turçtâja (10).
4. Atskrûvējiet rokturi (7) no pistoles (1).
5. Izðemiet filtru (5) caur roktura augðu (7).
6. Iztîriet filtru (5). Lai atdalîtu un notîritu gruþu pârpaklikumus izmantojet mîkstu suku.
7. Iestipriniet tîru filtru (5) rokturi (7).
8. Atkal pievienojet rokturi (7) pistolei (1). Stingri pievelciet.
9. Piestipriniet atpakaï trigera aizsargu (19) aizsarga turçtâjam (10).

Remonts

Nepiecieðamie instrumenti:

- 8- colliga regulcama uzgrieþou atslcga
- 1/4-colligs uzgrieþou skrûvçjamais

Nomainot atatu

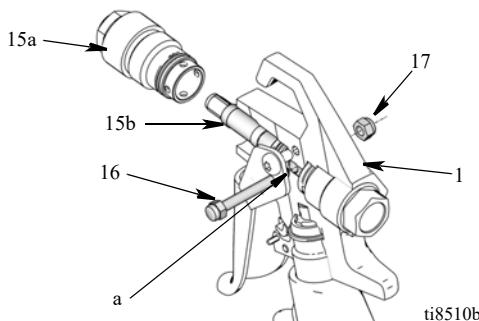

ti8510b

BÎSTAMÎBA



1. **Atlaidiet spiedienu.** Uzlieciet trigera droðības slēdzi (2).

2. Noðemiet uzgali (26) un aizsargu (25) no pistoles (1).
3. Atvienojiet ūidruma ūiûteni no pistoles pie ðarnîra (8).
4. Noðemiet uzgriezni (17) un izðemiet trigera tapiòu (16).
5. Izskrûvējiet difuzoru (15a) no pistoles gala (1).
6. Izðemiet adatas mezglu (15b) caur pistoles galu (1).
7. Pistoles iekðjo kanâlu tîrîðanai izmantojiet mîkstu suku.
8. Ieeðojet jaunâs adatas o-gredzenus ar smçrvielu bez silîcija.
9. Virziet jauno adatu (15b) caur pistoles galu (1) pârliecinoties, ka plakanie sâni (a) adatas mezglam vçrsti uz pistoles korpusa sâniem.
10. Ievietojiet difuzoru (15a). Pievelciet difuzoru lîdz 26-30 pçdâm mârcioâm (35,25 - 43,38 N·m).
11. Nomainiet tapiòu (16) un uzgriezni (17).

Iztulkotâs rokasgrâmatas

Spânski - 312098	Igauniski - 312277
Franciski - 312099	Latviski - 312278
Holandiski - 312265	Lietuviski - 312279
Vâciski - 312266	Poliski - 312280
Itâliski - 312267	Ungâriski - 312281
Turciski - 312268	Èehiski - 312282
Grieñiski - 312269	Slovâku valodâ - 312283
Horvâtiski - 312270	Slovçou valodâ - 312284
Portugâliski - 312271	Rumâniski - 312285
Dânski - 312272	Bulgâriski - 312286
Somiski - 312273	Íanieðu valodâ - 312287
Zviedriski - 312274	Japâniski - 312288
Norvçiski - 312275	Korejieðu valodâ - 312289
Krieviski - 312276	

Iztulkotâs rokasgrâmatas var pasûtît pie izplatîtâja vai pa www.graco.com.

Tehniskie dati

Maksimâla darba spiediens	3600 psi (248 bar, 24,8 MPa)
Ùidruma sprauslas izmçrs	0,125 collas (3,18 mm)
Svars (ar uzgali un aizsargu)	22 unces (630 g)
Ieplûde	1/4 npsm ðarnîrs
Maksimâla materiâla temperatûra	120°F (49°C)
Saslapinâtâs daïas	Nerûscjoðais tçrauds, poliuretâns, neilons, alumînijjs, volframa karbîds, pret ūidinâtâjiem izturîgs elastomçrs, bronza
Trokðou límenis*	
Skaðas jauda	87 dBA
Skaðas spiediens	78 dBA

*Mçrits 3,1 pçdas límeni (1m) izsmidzinot üdenskrâsu, îpatnçais 'blîvums 1,36, caur 517 uzgali pie 3000 psi (207 bar, 20,7 MPa) atbilstoði ISO 3744

For complete warranty information contact your local Graco distributor, call Graco customer service: 1-800-690-2894 or visit our website: www.graco.com.

All written and visual data contained in this document reflects the latest product information available at the time of publication.

Graco reserves the right to make changes at any time without notice.

For patent information, see www.graco.com/patents.

Orîginâlâs instrukcijas tulkojums. This manual contains Latvian. MM 311861

Graco Headquarters: Minneapolis
International Offices: Belgium, China, Japan, Korea

GRACO INC. AND SUBSIDIARIES • P.O. BOX 1441 • MINNEAPOLIS MN 55440-1441 • USA
Copyright 2007, Graco Inc. All Graco manufacturing locations are registered to ISO 9001.

www.graco.com

Revised J, October 2018